


I, Kevin C. Wall, certify that this plat was drawn under my supervision from an actual survey made under my supervision (deed description recorded in Book 409, pages 509, 519); that the boundaries not surveyed are clearly indicated; that the ratio of precision as calculated is 1:10,000+; that this plat was prepared in accordance with G.S. 47-30 as amended. Witness my original signature, license number and seal this twenty-second day of November, A.D., 2011.

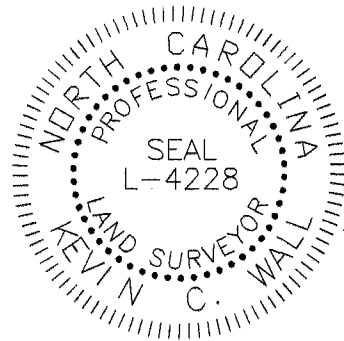

Kevin C. Wall
License No. L-4228

G.S. 47-30 (f)(11)(c1)
That the survey is of an existing parcel or parcels of land and does not create a new street or change an existing street.

State of North Carolina, County of Davidson.

I, *Scott L. Linn* Review Officer of Davidson County certify that the plat to which this certification is affixed meets all statutory requirements for recording.

11/23/11
Date

[Signature]
Review Officer

Danny T. Byerly
Eva L. Byerly
DB 650 Pg 82

±6.78 Acres
0.25 Acre Within
SR 2351 Road R/W
DB 409 Pg 509
DB 409 Pg 519

Wayne L. Hill
Barbara Y. Hill
DB 659 Pg 653
DB 677 Pg 307

PROFESSIONAL LAND SURVEYING
KEVIN C. WALL
PO BOX 697
DENTON, NC 27239
336-859-1955

Boundary Survey for Buyer
Archie L. Honbarrier
Davidson County, North Carolina
Healing Springs Township
Tax Map 14, Parcel 11
Deed Book 409, Page 509
Deed Book 409, Page 519
Field Work By: SW-KW
Mapped By: KW
Date of Survey: 11/22/11
Job# D 2255

Railroad Spike Found

N 78°56'14"W
Tie 265.71'

Flat Swamp Road
SR 2351 (Paved)(Public)
Subject to R/W per NCDOT

Tall Axle-Bent Found 0.2' East of PL

3/4" Iron Pipe Found

Edge of Pavement

30.00' 21.71'

315.67'

1.5" Tall Iron Pipe Found 0.4' East of PL

296.84'

(863.92')

N 07°59'53"E

101.33'

1.5" Tall Iron Pipe Found

1.5" Tall Iron Pipe Found 0.3' North of PL

N 83°11'07"W
Tie 266.94'

155.73'

S 81°12'04"E

83.09'

(309.68')

16.89'

53.97'

877.80'

880.07'

12" RCP

16.5' Strip is part of DB 601, Pg 819 Tract #2

30'

30' R/W as shown on survey for Wayne Hill, dated Oct. 1987 by James T. Hill, PLS# L-2512

Wood Barn

N 05°01'46"W

(912.80')

N 05°01'46"E

(915.07')

12" RCP

N 35°05'23"E

Tie 584.65'

1" Iron Pipe Found

35.00'

35.00'

35.00'

35.00'

35.00'

35.00'

35.00'

35.00'

35.00'

35.00'

35.00'

35.00'

35.00'

35.00'

35.00'

35.00'

35.00'

35.00'

35.00'

35.00'

Billy R. Bowling
Sarah T. Bowling
DB 592 Pg 642
DB 600 Pg 179

Abbreviations
DB Deed Book
EP Edge of Pavement
PB Plat Book
PG Page
PL Property Line
RCP Reinforced Concrete Pipe
R/W Right-Of-Way
Δ Computed Point

60 0 60
Graphic Scale - Feet

Owner
Magilene Daniel Lanier
PO Box 101
Midland, NC 28107